



SERVICE BULLETIN

PRODUCT: Computer Monitor
BULLETIN: MON98-008
MODEL: CGB5607

SUBJECT: Improve H-Drive and Q410 (IRF630) Defects

BACKGROUND: In order to prevent the failure of Q410 the horizontal drive, S-Correction, and AFC feedback circuits have been changed.

SOLUTION: S-Correction parts D413, D415, D417, H-Drive parts C436 and D411, and an AFC feedback part C403 have all been changed.

PARTS LIST:

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
C436	2301-000231	C-Film,3.3nF,100V	2301-000013	C-Film,4.7nF,100V
C403	2301-000012	C-Film,2.2nF,100V	2201-000376	C-Ceramic,220pF,50V
D413	0401-000005	1N4148,75V,150MA	BH39-40305U	Jumper Wire,52mm
D415	0401-000005	1N4148,75V,150MA	BH39-40305U	Jumper Wire,52mm
D417	0401-000005	1N4148,75V,150MA	BH39-40305U	Jumper Wire,52mm
D411	0402-000128	1N4002GP	0402-000274	UF4004,400V,1A

Disclaimer: This information is provided "as is" without warranty of any kind either expressed or implied, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.